

# TECHNICAL BULLETIN

Yaesu U.S.A - Amateur Products Division - Technical Support


File No.:	TB-9711	Date:	01-30-97
Model:	FT-1000MP	Serial No. Range:	Problem Units

Problem:	1.8mhz Band spurious problem
----------	------------------------------

Expected Results of Modification:	Improve cross spurious problem on 1.8MHz
-----------------------------------	--

Component Value Changes: Local Unit		
Part Location No.	From	To
C4165	39pf K22170225 GRM40CH390J50PT	100pf K22170235 GRM40CH101J50PT

Local Unit

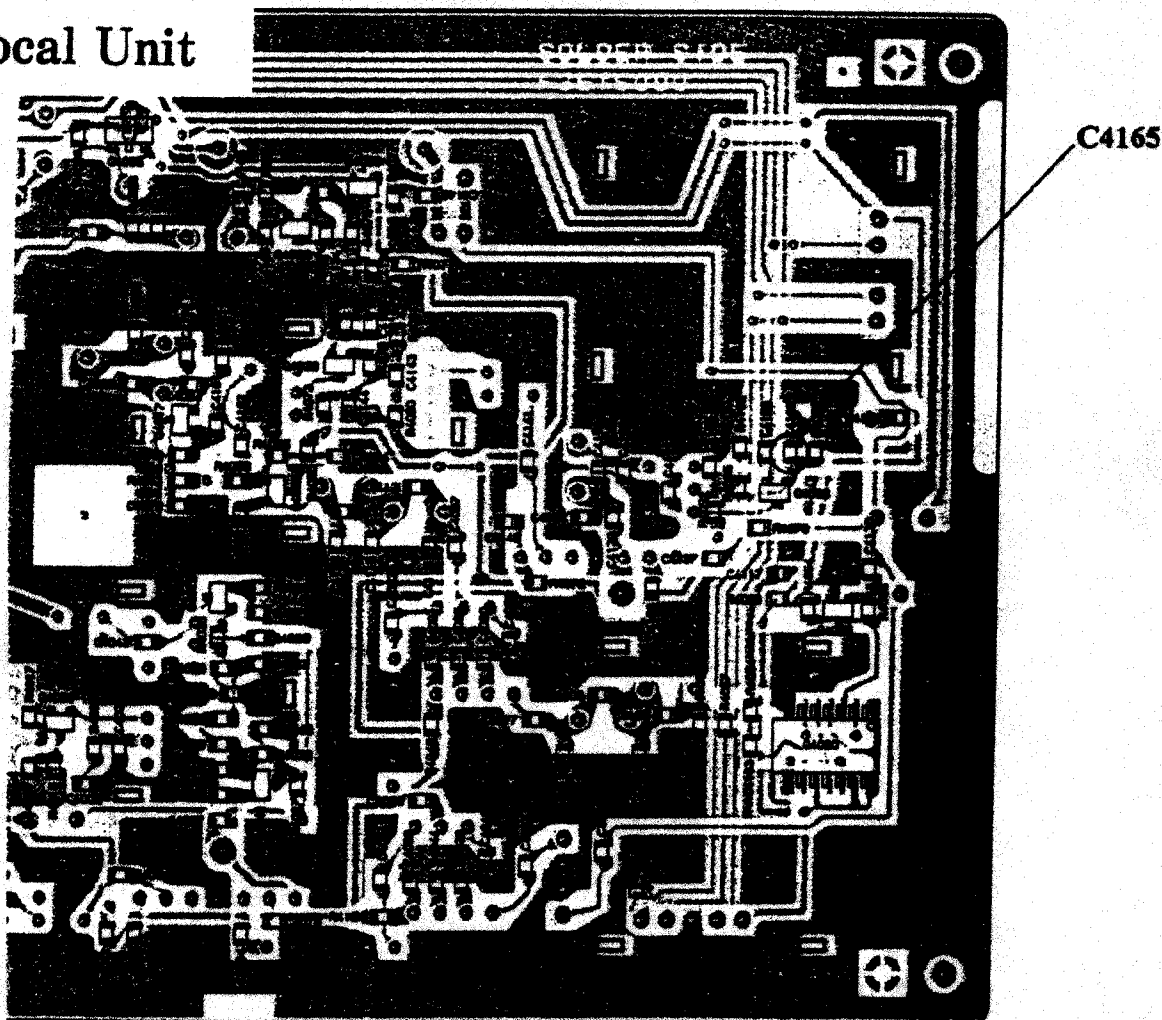

obverse view of chip-only side